




Sensor Showcase (Abbreviated)

Explore the built-in sensors on the micro:bit along with a 7 Segment Display to show values.

Written By: Pete Prodoehl

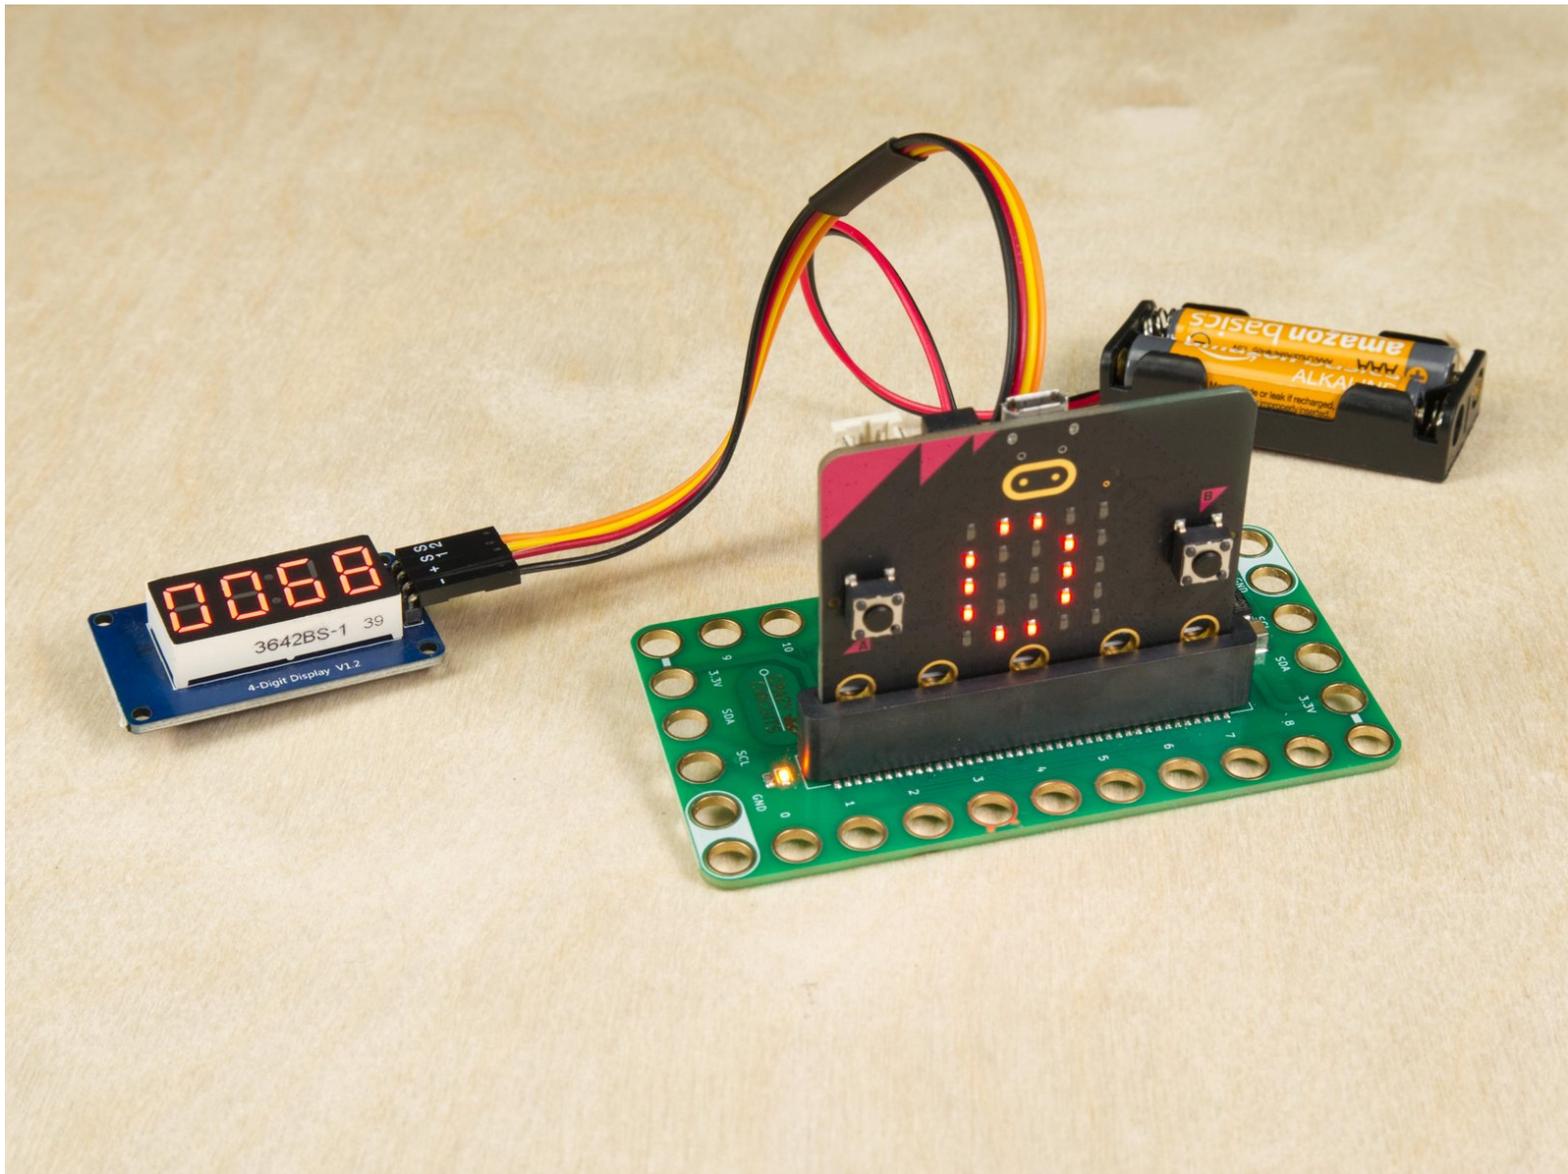

INTRODUCTION

Explore the micro:bit's built-in sensors by connecting a 7 Segment Display to show numerical data.

This is the *abbreviated* version of our full [Sensor Showcase](#). The full version uses an Ultrasonic Distance Sensor and also uses the built-in compass found on the micro:bit.

(This version does not use the Ultrasonic Distance Sensor and does not use the compass so no calibration is needed after loading the HEX file.)



TOOLS:


- [Computer](#) (1)



PARTS:

- [Crazy Circuits Bit Board](#) (1)
- [micro:bit](#) (1)
- [7 Segment Display](#) (1)
- [Crazy Circuits Ribbon Cable](#) (1)
- [Ceramic Magnets \(18mm\)](#) (1)

Step 1 — Sensor Showcase (Abbreviated)

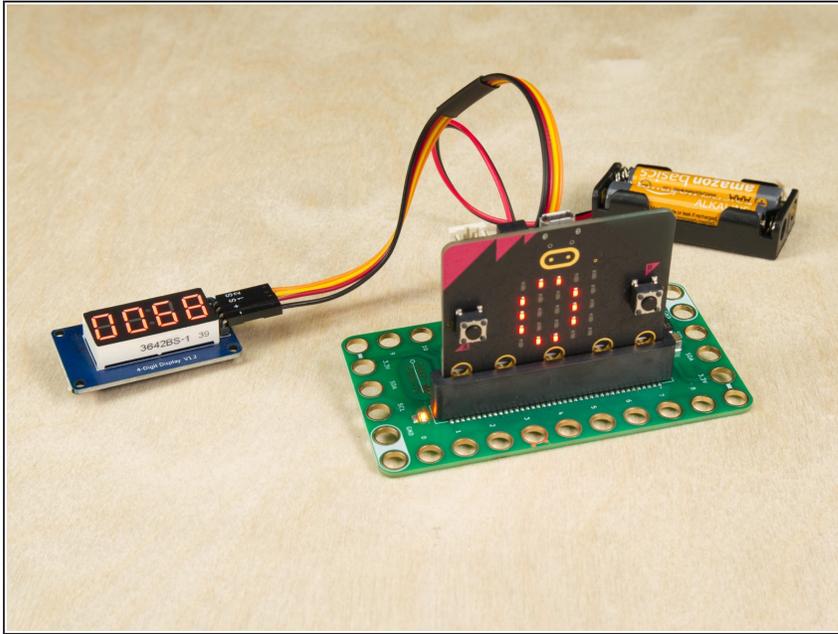

- The micro:bit has a number of built-in sensors which we'll explore with our **Sensor Showcase** code.
- We'll take measurements based around the follow sensors built into the micro:bit: **Temperature, Light Level, Sound Level, Acceleration, and Magnetic Force**.
- For each of the sensors we'll use a 7 Segment Display connected to the Bit Board to show numerical data from the sensor.
- You'll want some sort of magnet for testing, and a flashlight or phone on-hand as well.

Step 2 — Load the Code

```

on start
  led enable true
  set buttonCount to 0
  show number buttonCount
  set built-in speaker
  set volume 127
  CLK P0
  DIO P1
  set tm to Intensity 7
  LED count 4

on button A pressed
  change buttonCount by 1
  repeat buttonCount times
  do
    play tone High for 1/4 beat
    pause (ms) 25
  if buttonCount > 5 then
    set buttonCount to 0

forever
  show number buttonCount
  if buttonCount == 4 then
    call showMagneticForce
  else if buttonCount == 3 then
    call showAcceleration
  else if buttonCount == 2 then
    call showSoundLevel
  else if buttonCount == 1 then
    call showLightLevel
  else
    call showTemperature

function showTemperature
  tm show number temperature (C)
  pause (ms) 1000
  tm show number temperature (C) x 1.8 + 32
  pause (ms) 1000

function showLightLevel
  tm show number light level
  pause (ms) 100

function showSoundLevel
  tm show number sound level
  pause (ms) 100

function showAcceleration
  tm show number acceleration (mg) y
  pause (ms) 100

function showMagneticForce
  tm show number magnetic force (uT) strength
  
```


⚠ If you've never used a micro:bit before you'll want to check out this guide: [Bit Board V1 Setup and Use](#)

ⓘ Note we recommend a **micro:bit V2** (or higher) as the V1 lacks the microphone and speaker.

ⓘ You can use a **Bit Board V1** or later for this project.



- We're going to load the following code for our **Sensor Showcase Abbreviated** program: https://makecode.microbit.org/_Yricj_aa7f...

Step 3 — Add Jumper Wires

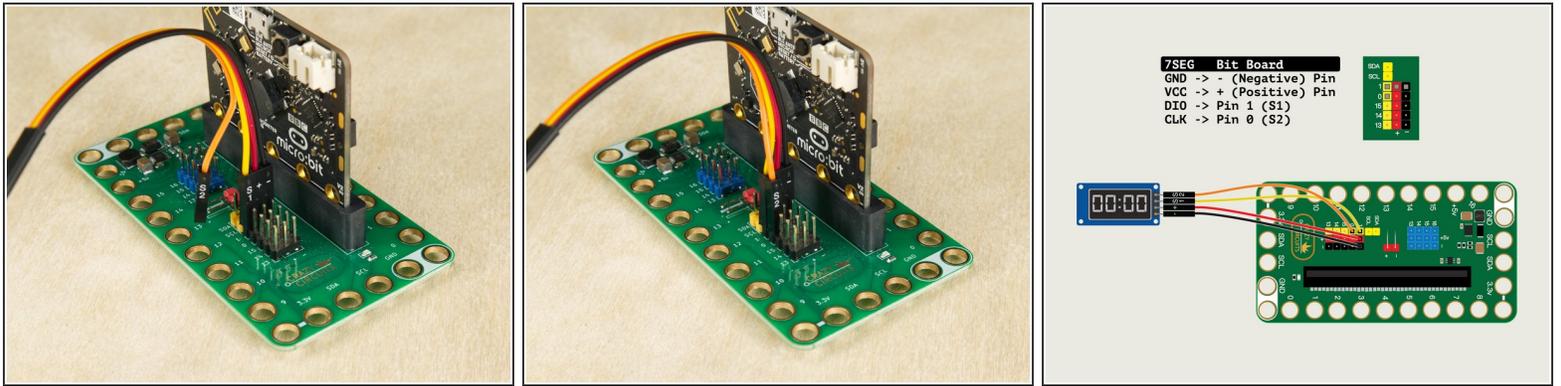


- We'll add the 7 Segment Display by using a [Crazy Circuits Ribbon Cable](#). Since each wire is labeled (and color coded) it's easy to make the connections.
- ☑ If you don't have a Crazy Circuits Ribbon Cable any Female/Female jumper wires will work as long as you make all of the connections properly.
- Plug the large connector (with three wires) into the Bit Board, so **S1** aligns with **Pin 1**. This will put **+** (the Red wire) into **+** (Positive) and **-** (the Black wire) into **-** (Negative) or **GND**.
- This leaves **S2** not connected, so we'll plug that into **Pin 0** on the Bit Board.
- Once the wires are connected to the Bit Board we can add the 7 Segment Display.

Step 4 — Add 7 Segment Display

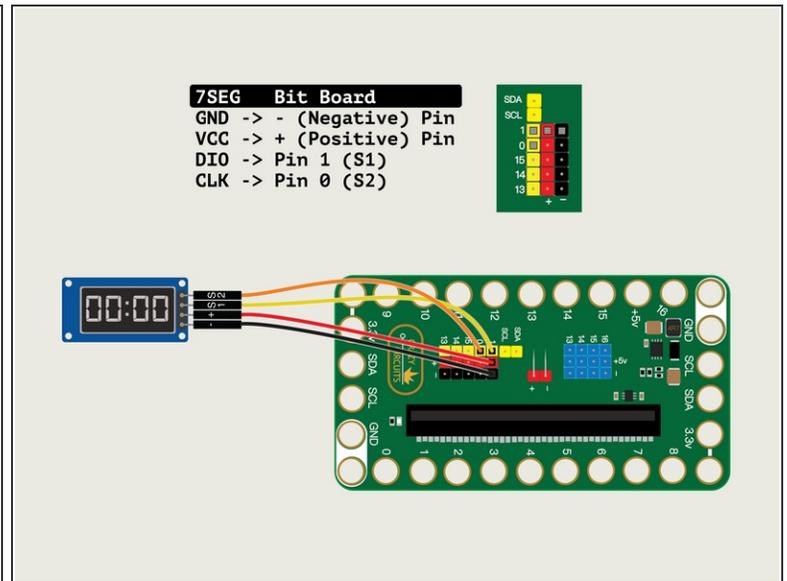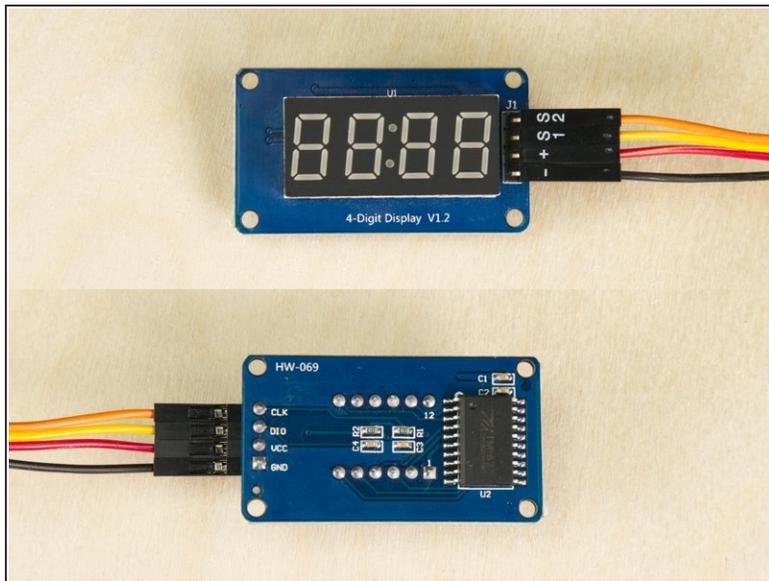


- The 7 Segment Display has four pins. We'll connect the - wire to **GND**, the + wire to **VCC**, the **S1** wire to **DIO** and the **S2** wire to **CLK**.
- With the 7 Segment Display connected we're ready to start sensing!

Step 5 — Add Power

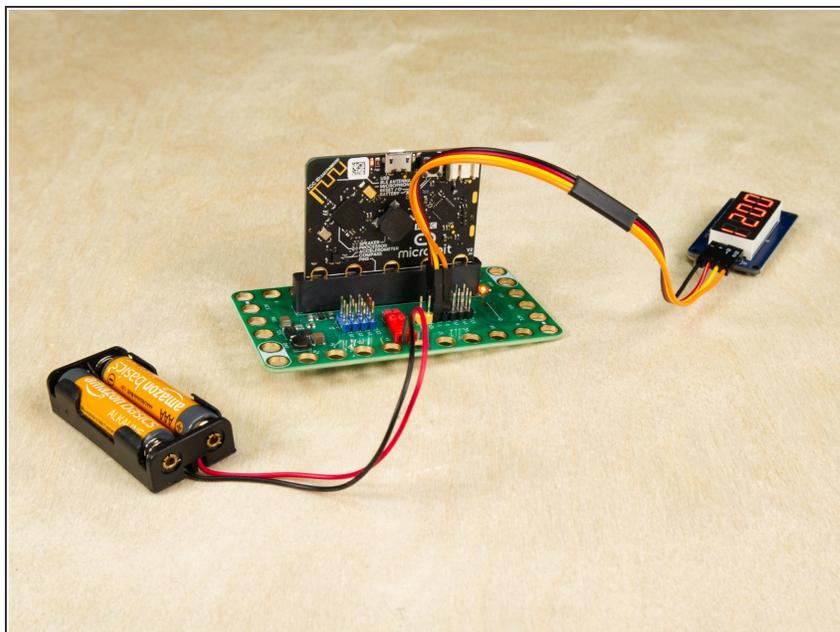


- While testing various sensors you'll be moving the Bit Board and micro:bit around, so it may be easier to use the battery pack rather than the USB cable to power the circuit. (Though either will work just fine.)

Step 6 — Ready to Sense!

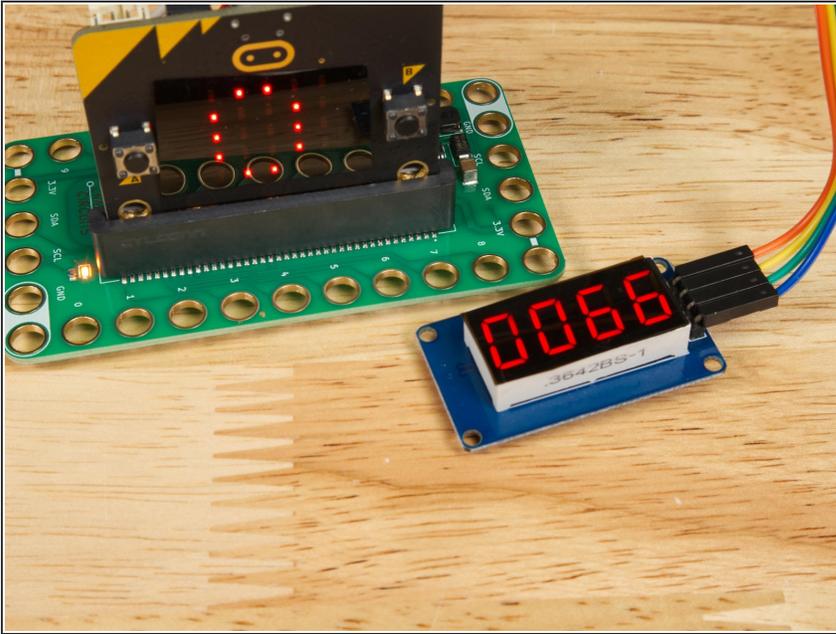


- Now that we've got the code loaded and the 7 Segment Display connected we can walk through the various sensor examples.
- There are 5 modes you can cycle through. When you start up the micro:bit it will be on "0".
- The built-in LED matrix on the micro:bit will show which mode you are in. (0 through 4)
- To go to the next mode press the "A" button on the micro:bit

Step 7 — Mode 0: Temperature

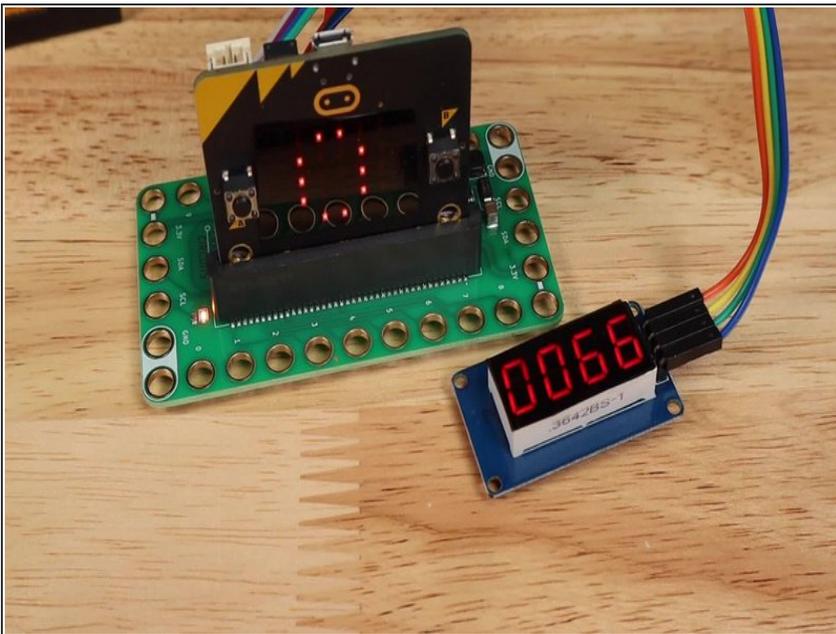


- The display will show the temperature, alternating between Fahrenheit and Celcius every second.
- ⓘ If you hold the micro:bit so your finger can press against the processor you may see the temperature rise.
- The processor is the black square on the back of the board behind the "B" button.

Step 8 — Mode 1: Light Level

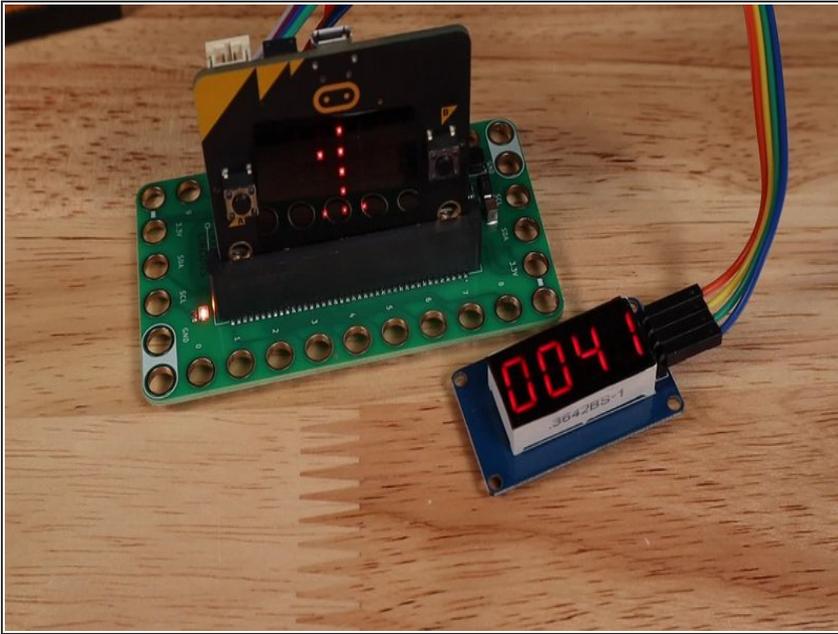


- The display will show the light level with a value between 0 (dark) and 255 (light).
- You can use a flashlight (your phone's flashlight feature works great!) to see the values change. Just shine it at the front of the micro:bit and move it closer and farther away.
- You can cover the micro:bit with your hand and it will probably go to zero (or very close) in most situations.

Step 9 — Mode 2: Sound Level

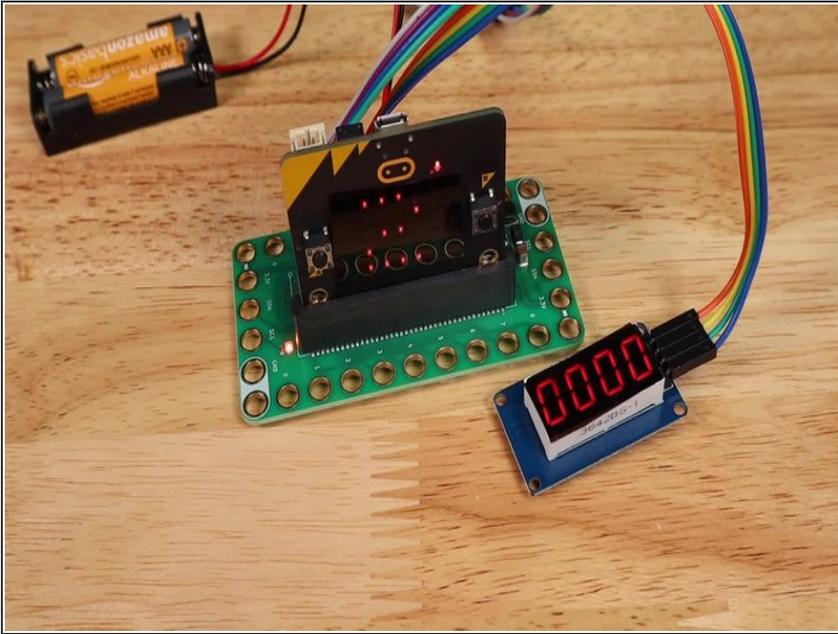


- The display will show the sound level with a value between 0 (quiet) and 255 (loud).
- Try clapping or whistling in front of the micro:bit to see the values change.
- If you have a tone generator app on your phone you can adjust the frequency and volume to see how the values might change.
- ⓘ Depending on your age and hearing abilities you may be able to play tones that the micro:bit can hear but you cannot!
- ✦ We've used [Tone Generator](#) (for iPhone and Android) with good results.

Step 10 — Mode 3: Acceleration (Y axis)

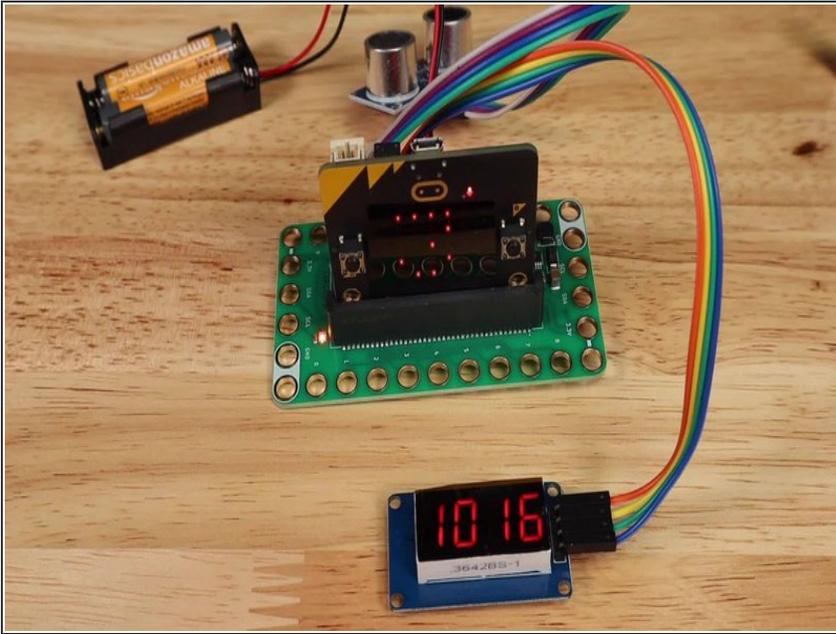


- The display will show the angle of the micro:bit with a value between -1023 and 1023.
- ⓘ Actually, -999 is the lowest value you will see on the 7 Segment Display since the minus sign takes up the first digit position.
- Tilt the micro:bit to the left, and to the right, and you will see the values change.
- When tilted 90 degrees to the right or left the value should be near zero.
- When the micro:bit and Bit Board are sitting flat on the table the value should be very close to 1024.

Step 11 — Mode 4: Magnetic Force

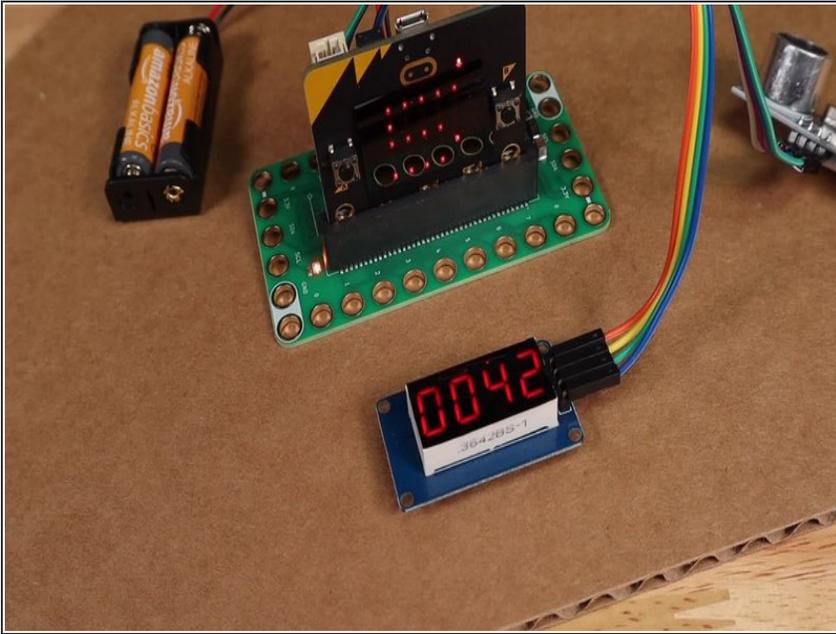

- The display will show a value relative to the magnetic field it can detect.
- On our workbench we saw a start value of **45** and a high value of about **3100** using a single ceramic magnet.
- The results of this activity will vary depending on the magnet you use, but even with a small Neodymium magnet we saw great results, with a high of **2700**.
- Start with your magnet about 15 centimeters in front of the micro:bit and slowly move it closer. The value shown should increase the closer the magnet gets.
- ⓘ **Tip:** Try rotating the magnet to see how the magnetic field change and how that affects the value shown.
- ⚠ **Note:** The video shows a "5" on the LED matrix instead of a "4" but you can safely ignore that.

Step 12 — Sensational Sensors!

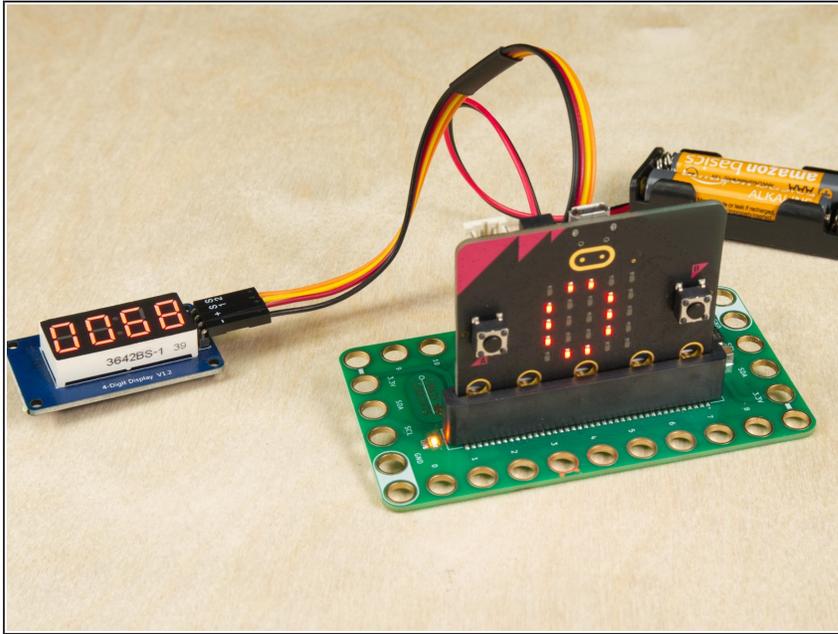

- We hope this walk-through of the various sensors served as a good introduction to some of the things the micro:bit can sense.
- The sensors can be valuable for exploring the world and recording data, and as you learn about each sensor, you might get ideas for programs you can create that use the sensors.
- You could use the light sensing abilities to control a circuit with a flashlight, or sound sensing to play a series of beeps if the room gets too loud.
- Integrating sensors into your projects can open a world of possibilities beyond switches and logic, and truly allows the micro:bit to react to the world.